




ENGINEERS, INC.

CONSTRUCTION INSPECTION REPORT

Project: Knudson Cove Harbor				Report No: Pool – 018			
File No: 062010.05 C-2				Date: February 23, 2009			
Consultant: PND Engineers, Inc.				Day of the Week: Monday			
WEATHER	Bright Sun	Clear X	Overcast	Rain	Snow	Other	
TEMP	Below 0	0-32	32-50 X	50-70	70-85	Over 85	
WIND	Still	Mod X	High	Comments:			
HUMIDITY	Dry	Mod X	Humid	Comments:			
<u>Name of Contractor</u>		<u>Non-Manual</u>		<u>Manual</u>		<u>Remarks</u>	
Pool Engineering		1		4			
CONTACTS							
<u>Name</u>		<u>Title</u>		<u>Phone No.</u>		<u>Remarks</u>	
John Pool		Project Manager		907-617-1615			
FIELD ACTIVITIES							
<p>At pile H8 Contractor placed drill casing in pile hoop to continue drilling were 3ft. of pile socket was still needed. They drilled at this location for 1hr., very little advancement was made. Due to high tide and a short drill casing, Contractor was forced to remove drill and casing before damage to the floats occurred. With the rising tide, light damage was done to the pile hoop galvanizing from the drill leads. Contractor will repair per specification.</p> <p>Contractor continued to drill at pile location H7. They drilled at this position for 5hrs were a total of 5ft. socket depth was achieved. When pile H7 was initially vibrated into position, 15' of overburden was encountered. Engineer agreed that only a 5ft. pile socket was need at this location.</p>							
PHOTOS TAKEN							

CONSTRUCTION INSPECTOR: Lance Greer


DATE: February 23, 2009

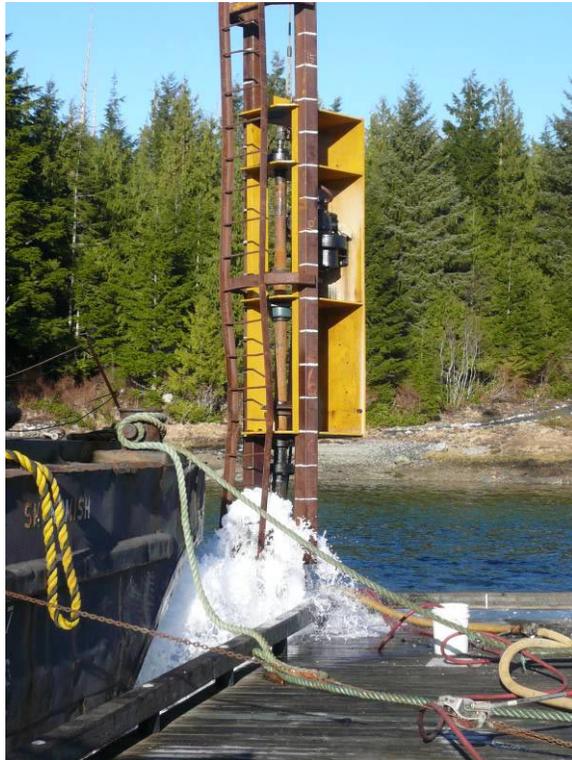

Photograph No. 1

Description:

Rock socket drilling for pile H8.

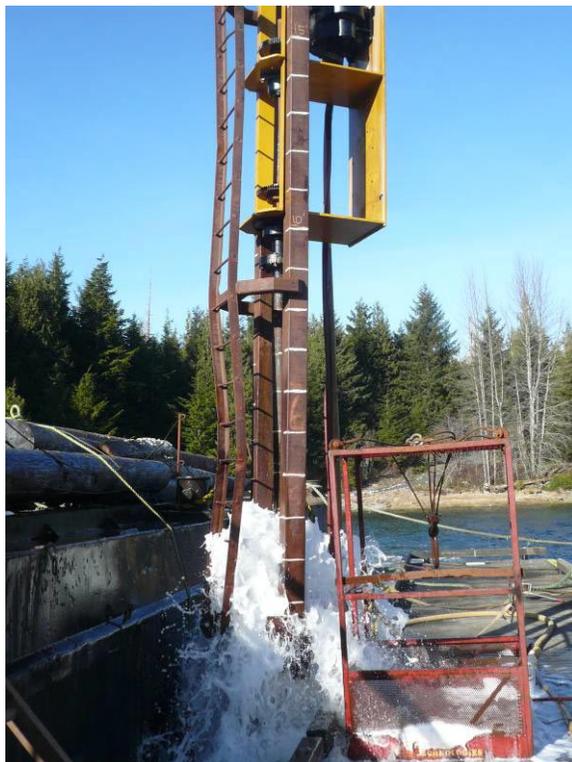

Photograph No. 2

Description:

Rock socket drilling for pile H7.